

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

U/R

OK CP 14/6/12

Page 1

Item ID: D119-646-041

Accept

N900040100

Setup Start

NS1

Revision ID: URF 15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop

NS2

Start Date: 6/2/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/23/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: **MAY 25 2016**

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

NR1

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-041	D								
IIN-D119-646	C								

100

0.00

100

DC

Doc.Control -USB or Paperwork

Memo

0.00

Photocopy bluefile & type labels per PPP D119-646-041 CHG004

N/A *[Signature]*

110

0.00

110

Skidtubes

Skidtubes

Memo

0.00

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

[Handwritten: 16-6-7]

DAS
19
8-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

Page 2

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.00							
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00							
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00							
Quality Control									

DAS
18
9-89DAS
18
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

Page 3

Item ID: D119-646-041

Revision ID: URF 15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 *1*

Required Date: 6/23/2016 Req'd Qty: 1.00 *1*

Reference:

Accept

N900040100Setup Start ***NS1***Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

0.00

130

Skidtubes

Skidtubes

Memo

0.00

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477

4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & QSI 015.

A/RSikaflex-291 134743Sikaflex expire date: 16-12-8Start: _____ Time: 10455Finish: _____ Time: 11420

***** (Adhere for 12 hours) *****

16-6-10 M.G.

16-6-10 M.G.

16-6-14 M.G.

16-6-14 M.G.

DAS
19
9-09

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

Page 4

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop ***NS2***Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O 0.00

135

QC

Memo

0.00

Quality Control

**DAS
18
9-99**1 0 16-06-15

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
				OTHER : ☐							

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

Page 5

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 6/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140		0.00							

140

Skidtubes

Skidtubes

Memo

0.00

- 1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***
- 2- Cut FWD end of tube as per dwg D3887.***Verify measurement***
- 3- Buff out marks left from bending
- 4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"
- 5- Open FWD saddle holes to finished size as per dwg D3887
- 6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)
- 7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size.
- 8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.
- 9- C'sink FWD cap hole as per detail "C"
- 10- Drill holes for wearpads using DT8931, open to 0.297".
- 11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.
- 12- Deburr and blow out chips from inside of tube.

16-6-15

16-6-16

DAS
19
2:58

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : _____											

Work Order ID 146617

146617

Page 6

Thursday, May 19, 2016 2:58:27 PM

Item ID: D119-646-041 Accept *N900040100* Setup Start *NS1*
Revision ID: URF 15-560 Stop *NS2*
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 6/2/2016 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 6/23/2016 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.00

Quality Control

DAS
18
9-20

1 0 16-06-16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/ Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

Page 7

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 6/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

160

Skidtubes

Skidtubes

Memo

0.00

NOTE:TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD
GROUND HANDELING FIXTURE,IF FIXTURE FITS WELL THEN
PROCEED. FIXTURE DT10091.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to
back drill each hole before welding the other side. Use aluminum rod
A/RAluminum Rod M34440

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore 5/16" x 0.750" deep as per Dwg D3887. - on 16/06/20

4- Deburr & Scribe batch # on Aft end of tube. 16-6-20 Jk

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Quality Control

Memo

0.00

TEST FIT USING FIXTURE DT10091.

**DAS
19
9-89****DAS
38
9-89**

JUN 21 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval				
Description Work Order Deviation				Disposition				Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : ☐											

Work Order ID 146617

Thursday, May 19, 2016 2:58:27 PM

146617

Page 8

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: URF 15-560 Stop ***NS2***
 Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
 Start Date: 6/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 6/23/2016 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	QC10- Inspect visual per QSI004- ground welds	0.00				1			8 DAS 38 9-89 JUN 21 2016
180									
QC	Memo	0.00							
Quality Control									

190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.00							
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.								

200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200									
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 3:35 OVEN TEMPERATURE: 300° FINISH TIME: 4:05								

★
SEE
Attached

1 16-6-21 16-6-22
 1 16-06-22
 DAS 34 9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			

Work Order ID 146617

Thursday, May 19, 2016 2:58:28 PM

146617

Page 9

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 6/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp	
210	QC3- Inspect Part Finish	0.00								
210										
QC	Memo	0.00				1x	0	16/06/23		
Quality Control										
220		0.00								
220										
HandFinish	Memo	0.00				1x	0	16/06/23		
Hand Finishing	1-Install inserts as per Dwg D3887.									
230	QC5- Inspect part completeness to step on W/O	0.00								
230										
QC	Memo	0.00				1	0	1606-23	234	9-89
Quality Control										

DAS
15
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY					
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐				Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
				OTHER : ☐					

Work Order ID 146617

Thursday, May 19, 2016 2:58:28 PM

146617

Page 10

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish		0.00							
Hand Finishing	Memo 1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 <u>M1134743</u> Sikaflex expire date: <u>16112</u> 2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: <u>M1133145</u> 3 -Inspect for foreign objects as per OSI 024 <u>RTU 598 M134524 16107</u> 4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 <u>M1134743</u> Sikaflex expire date: <u>16112</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC		0.00							
Quality Control	Memo								

1

16106123

38

9.88

JUN 23 2016

DAS
38

JUN 23 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐								
Misidentified	☐	Past Due	☐	OTHER : _____							

Work Order ID 146617

Thursday, May 19, 2016 2:58:28 PM

146617

Page 11

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Wing Walk as per dwg QSI005 4.4 Batch <i>14134948</i>	0.00							
250	HandFinish	0.00							
Hand Finishing	Memo								
251	QC3- Inspect Part Finish	0.00							
251	QC	0.00							
Quality Control	Memo								
260	Identify as per dwg & Stock Location <i>u/p</i>	0.00							
260	Packaging	0.00							
Packaging	Memo <i>148078</i>								

*12 of 11 16/06/25**1* **DAS 33 9-89**
JUN 23 2016*1X* **DAS 36 9-89**
16/06/28

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Work Order ID 146617

Thursday, May 19, 2016 2:58:28 PM

146617

Page 12

Item ID: D119-646-041**Accept*****N900040100*****Setup Start *NS1*****Revision ID:** URF 15-560**Item Name:** Replacement Skidtube with Wearpads, Fits LH or RH**Stop *NS2*****Start Date:** 6/2/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 6/23/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

270

QC21- Final Inspection - Work Order Release

0.00

270

QC

Memo

0.00

Quality Control

16/6/28 JH

JH 6/28/16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, May 19, 2016 2:58:26 PM

Page 1

Work Order ID: 146617

146617

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/23/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
10.02.22 per PAR 09-043 EC verified by:DD IPP rev B
10.02.22 per PAR 09-043 EC verified by:DD IPP REVC 12.11.05
(DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-190		Manufactured	No			110	Each	55.0000	1	1			DAS 19 8-89
D2500-1-190									**			16-6-7	
Ext'n -I' Beam Tube 4"													
					<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>						
					LG002	55				1			
					140538	55							
D2579		Manufactured	No			140	Each	193.0000	2	2			
D2579									**			8/16/06/16	
Crossbolt Spacer													
					<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>						
					LG001	193							
					123997	1							
					141711	192				2			
D2855-3		Manufactured	No			240	Each	25.0000	2	2			
D2855-3									**			16/06/23	
Cap													
					<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>						
					FP001	25							
					137525	25				X2			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, May 19, 2016 2:58:26 PM

Page 2

Work Order ID: 146617

146617

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/23/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased

No

240

Each

599.0000

16

16

NAS1611-005

O-RING

all 16/06/23

Location

Loc Qty

Loc Code

FP001

599

m129198

11

m133498

316

m134488

72

m134816

200

x16

D3492-5

Manufactured

No

240

Each

388.0000

16

16

D3492-5

Plug

all 16/06/23

Location

Loc Qty

Loc Code

FP001

388

133396

8

136396

6

138198

2

142818

372

B 142818

x16

D3672-1

Manufactured

No

240

Each

610.0000

2

2

D3672-1

Washer, Phenolic

all 16/06/23

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

46

112218

46

ST049

54

127322

54

ST051A

500

134785

500

x2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No.: _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, May 19, 2016 2:58:27 PM

Work Order ID: 146617

146617

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wepads, Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/23/2016

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No 160 Each 144.0000 8 8

D3681-1

Spacer

**

BE/606-16

Location Loc Qty Loc Code

LG001 144

142904

144

240 Each 17.0000 5 5

**

ll 16/06/23

D3847-1 Manufactured No

D3847-1

Wearpad

Location Loc Qty Loc Code

FP001 17

13146613

12

138338 10

13146614

X3

142854 7

240 Each 36.0000 1 1

**

ll 16/06/23

D3847-11 Manufactured No

D3847-11

Wearpad

Location Loc Qty Loc Code

FP001 36

138418 1

141896 11

142783 24

140 Each 0.0000 1 1

**

16-6-28

D3885-1 Manufactured No

D3885-1

Standard Web

D3903-1 Manufactured No

D3903-1

Spacer

**

BE/606-16

Location Loc Qty Loc Code

LG001 314

142730

314

12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Picklist Print

Page 4

Thursday, May 19, 2016 2:58:27 PM

Work Order ID: 146617

146617

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/23/2016

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130 AELS4-1032-130 Purchased No

220 Each 4,284.000 30 30

ALS4-1032-130******

Rivnut

LocationLoc QtyLoc Code

CCK005

2850

M134502

2850

FP001

1434

M133077

140

M134502

1294

AN3C5A Purchased No

240 Each 1,547.000 32 32

AN3C5A******

Bolt

LocationLoc QtyLoc Code

FG

5

122800

5

FP001

86

M134762

86

OVER002

1400

M134502

1000

M134676

400

ST350

56

M133234

56

Thursday, May 19, 2016 2:58:27 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Page 5

Thursday, May 19, 2016 2:58:27 PM

Work Order ID: 146617

146617

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/23/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

Each

4,395.000

32

NAS1149C0332R

all 16/06/23

WASHER

Location

Loc Qty

Loc Code

FP001

2048

M134962

x32

m132262

4

m132930

1004

m134063

26

m134073

128

m134574

886

GA

173

m133284

173

ST266

2174

m134474

74

m134654

100

m134736

2000

MS24694-C52

Purchased

No

Each

93.0000

2

MS24694-C52

all 16/06/23

SCREW

Location

Loc Qty

Loc Code

FP001

87

m127059

17

m133855

70

ST287

6

124308

6

x2

Thursday, May 19, 2016 2:58:27 PM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	Past Due ☐							

8 7 6 5 4 3 2 1

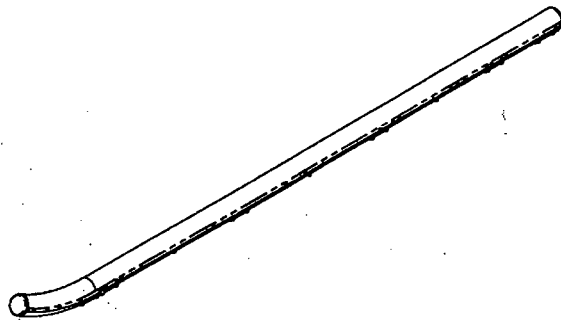

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEAPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2579	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3872-1	PHENOLIC WASHER
14	8	8	8	D3881-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		AL54-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C48A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN980C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24894-C52	SCREW

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.197 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.

SHOP COPY

RETURN TO

ENGINEERING

UNCONTROLLED COPY

SUBJECT TO AMENDMENT

WITHOUT NOTICE

WORK ORDER

NO. 146613 MW
16-05-25

RELEASED

2014 NOV 24

ECN 14-628

UNDER REVIEW

15.04.30 URF15-560 AP

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY. 135.07 WAS 134.04 (ZN D5-8). ADD 5.07 (ZN C2-8). ADD 118.8 (ZN D5-8). DELETE GASKETS (BOM, SH 2)	DB	13.09.20
C	(SHT1, PL, ZN C2-2, C2-3, C2-4) ITEM 13, QTY 2 WAS 4. ITEM 42, QTY 32 WAS 34. ITEM 44, QTY 30 WAS 32. ADD ITEM 46, MS24894-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) Ø0.201 CSK Ø0.385 X 100" WAS Ø0.214 THRU. ADDED DETAIL F (ZN C5-5, C5-6, B5-7). ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN D4-1, A8-7)	DB	13.02.19
B	AL54-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7). ADD DT8931 (ZN A8-1). ADD 134.04 (ZN C4-8). D2855-3 WAS D2575 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4). AN3C5A WAS AN3C48A (ZN C5-2, C5-2, C5-3, C2-3, C8-4, C2-4). Ø0.315 WAS Ø0.328 (ZN C4-6, C4-6, C2-7 & B3-7). REVISED NOTE N (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

1.5
1.5
1.5

2.00 DISTANCE TO D3885-1 WEB, REF

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

D3847-1
WEARPAD
5 PL

1.5
D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24684-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *ap*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS COVENANT THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

2.00 DISTANCE TO D3885-1 WEB

D3849-041
FWD TRAINING WEARPLATE ASSY

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *up*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 4 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRELIMINARY AND IS SUBJECT TO THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

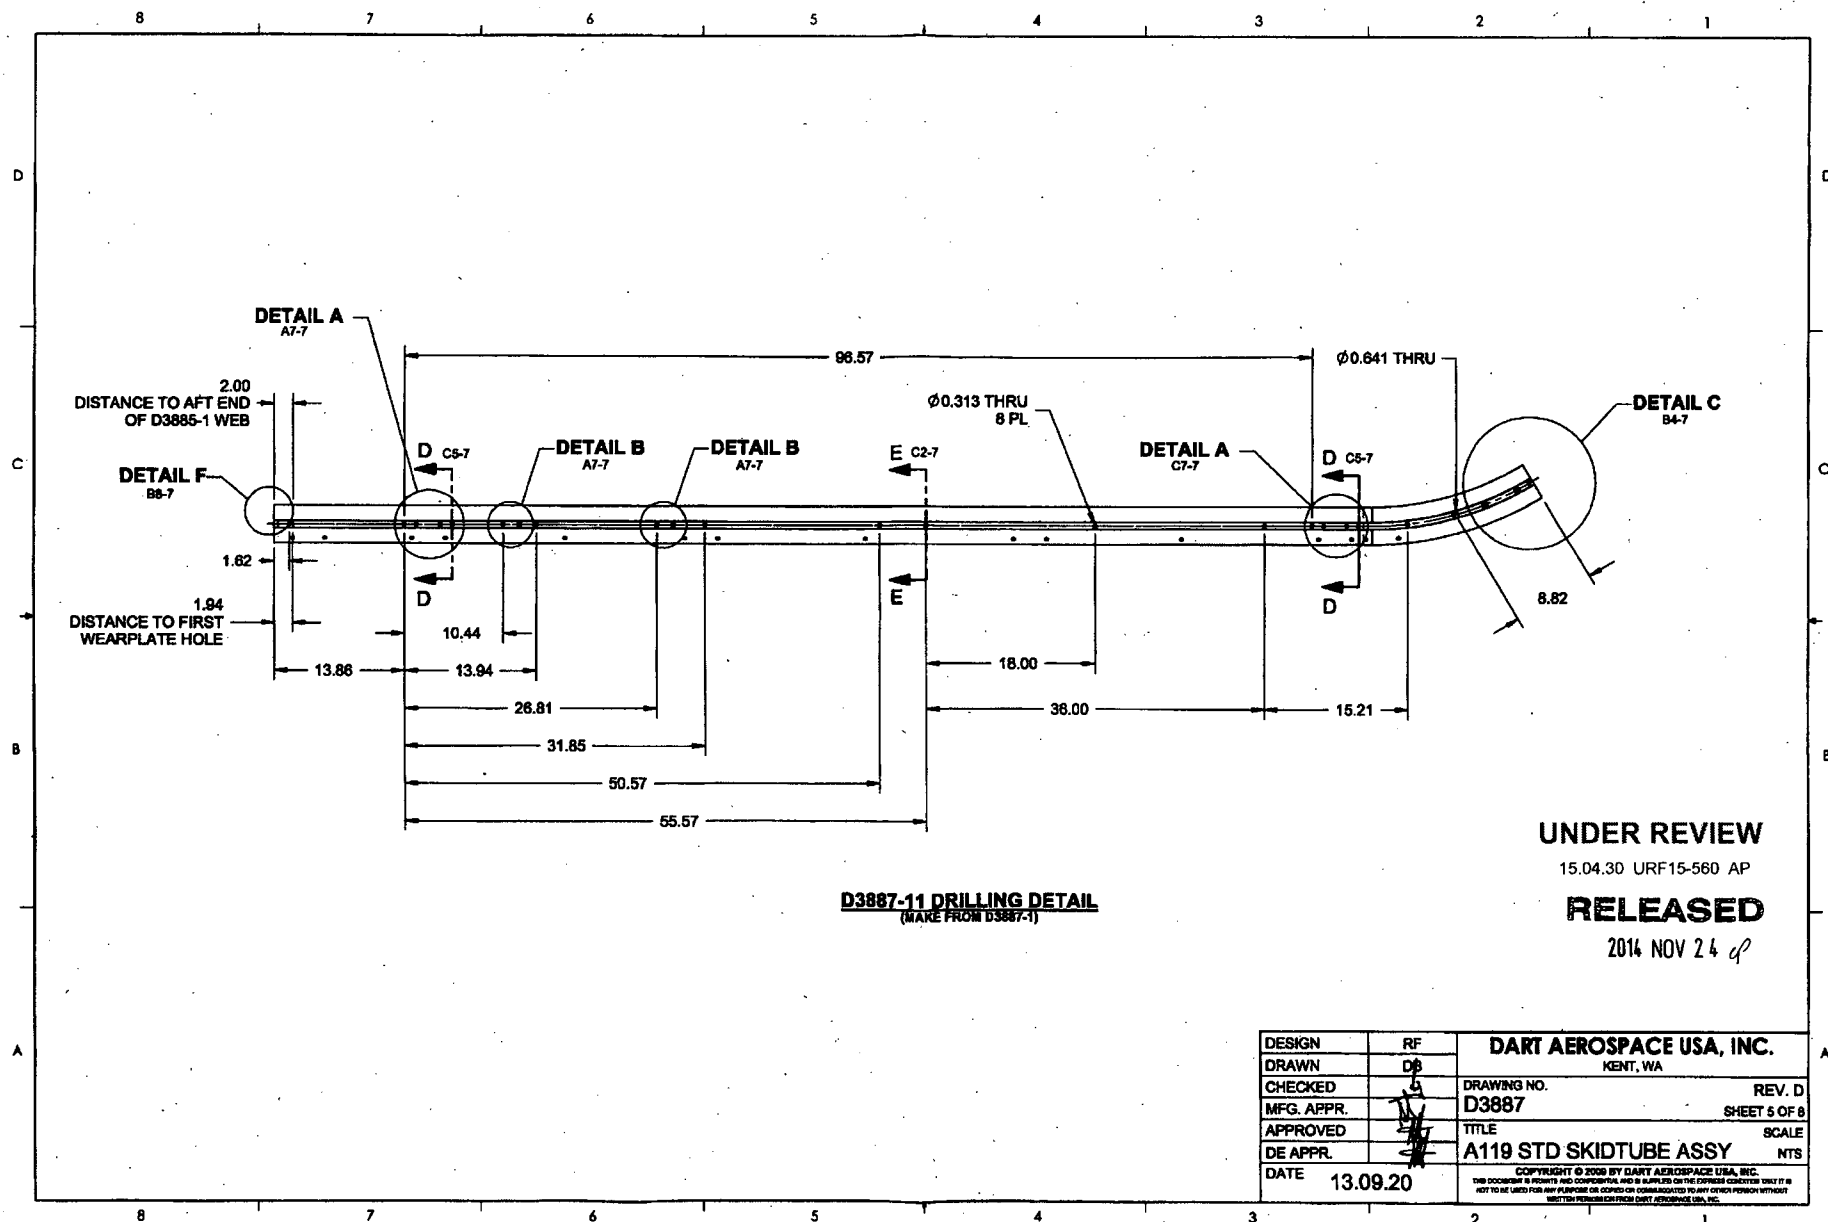

D3887-11 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *ap*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	DB	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 5 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE OPEN SOURCE BASIS IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

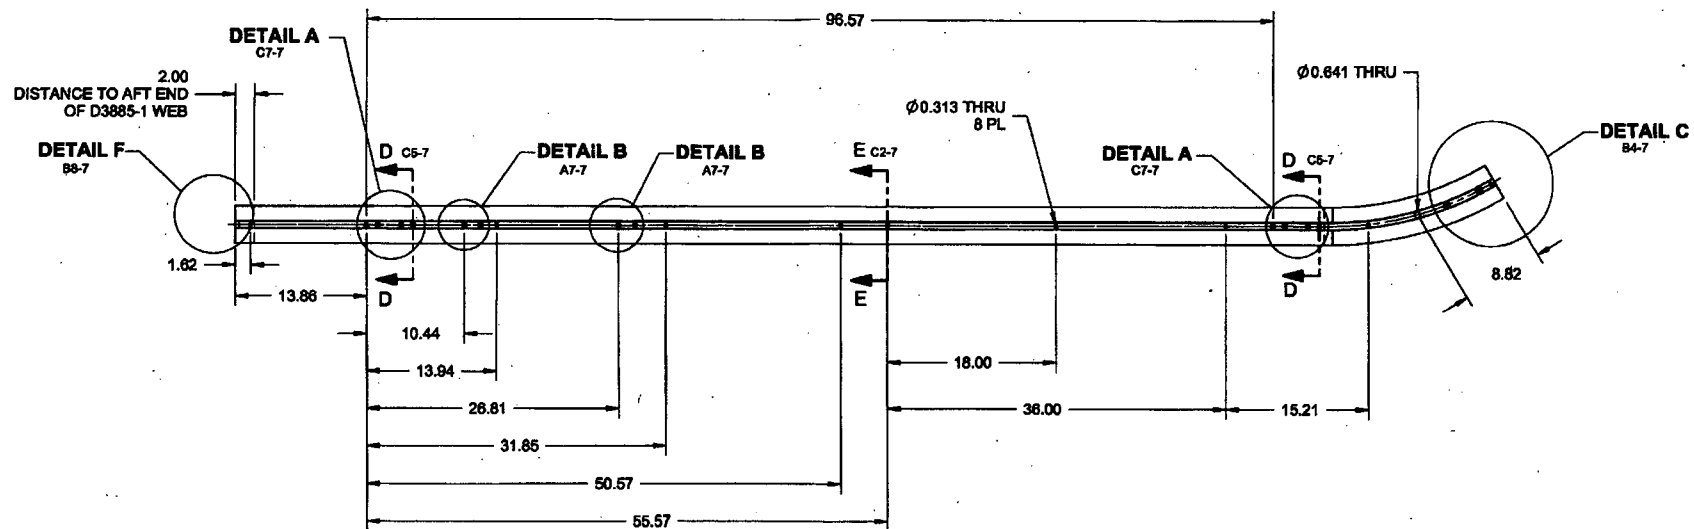

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *ap*


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 6 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

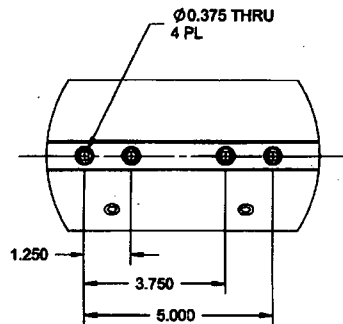


DETAIL A
SCALE 4X
D7-5
C3-5
D7-6
C3-6

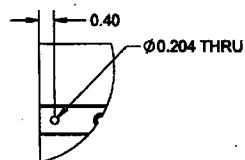


DETAIL F
SCALE 4X
C8-5
C8-6

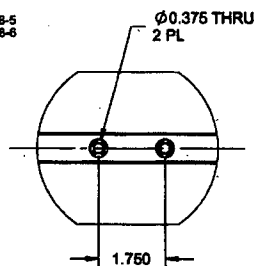


DETAIL B
SCALE 4X
C8-5
C8-6
C8-6
C5-6

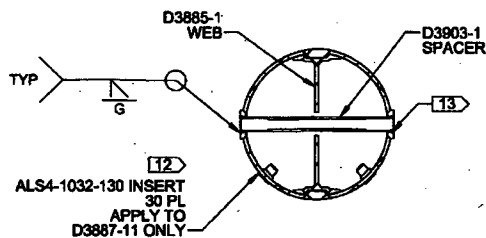

SECTION D-D
SCALE 4X
C7-5
C3-5
C7-6
C2-6
(FOR 12 X Ø 0.375 HOLES
PER SKIDTUBE)

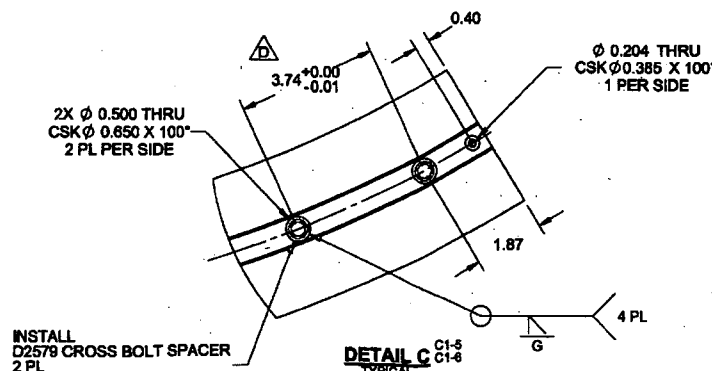

DETAIL C
SCALE 4X
C1-5
C1-6

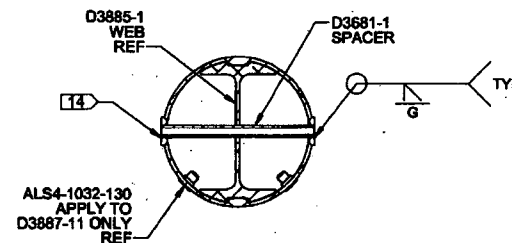

SECTION E-E
SCALE 4X
C4-5
C4-6
(FOR 8 X Ø 0.313 HOLES
PER SKIDTUBE)

NOTES:

13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø 0.375 HOLES ONLY:

- i) CHAMFER HOLES Ø 0.475 x 45°
- ii) INSERT D3903-1 SPACER
- iii) WELD INTO PLACE AND GRIND FLUSH
- iv) C'BORE TO 0.313 x 0.75 DEEP
- v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø 0.313 HOLES ONLY:

- vi) CHAMFER HOLES Ø 0.364 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
- vii) INSERT D3681-1 SPACER
- viii) WELD INTO PLACE AND GRIND FLUSH
- ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED FOR DISSEMINATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

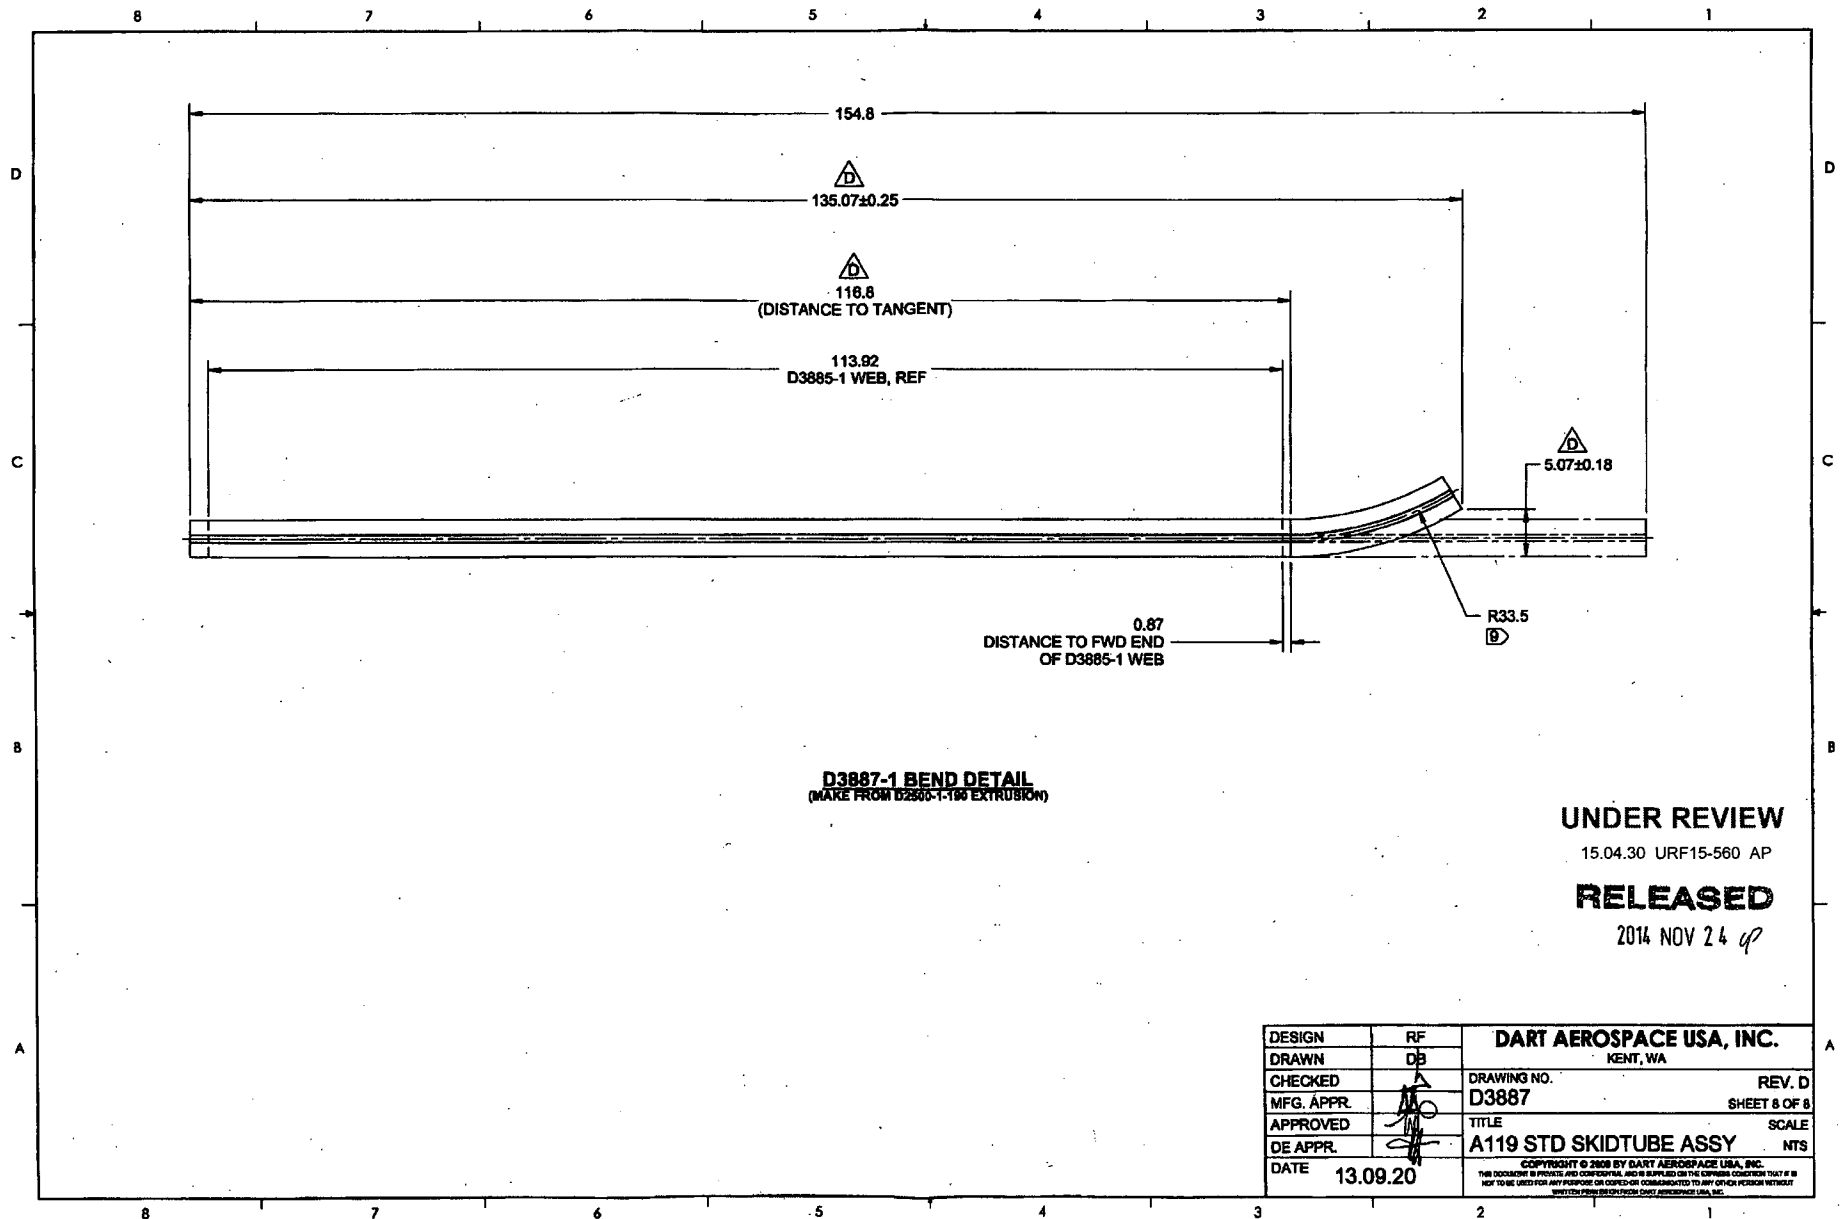

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

Work Order update only



Work Order: <u>146617</u> Part No. <u>D119-646-041</u> NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☒</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date: <u>16/5/16</u>		Step #: <u>200</u>		QTY Effective: _____		MRB (QSI042) Approval DAS 12 16/6/2 9-89																																																																	
Description Work Order Deviation				Disposition																																																																			
No powder coat on saddle region per customer request.				Acceptable per attached masking instructions				Completed By 16-06-22																																																															
								Lead hand / Supervisor Approval Verification																																																															
								QC / QA Coordinator Approval																																																															
Root Cause <table style="width:100%;"> <tr><td>Environment ☐</td><td>No Re-verification ☐</td></tr> <tr><td>Design ☐</td><td>Operator ☐</td></tr> <tr><td>Doc/Data ☐</td><td>Offset/Setup ☐</td></tr> <tr><td>Equip/Tooling ☐</td><td>Supplier ☐</td></tr> <tr><td>Handling/Pre ☐</td><td>Training ☐</td></tr> <tr><td>Material ☐</td><td>Use for Testing ☐</td></tr> <tr><td>Internal Transport ☐</td><td>Poor Information ☐</td></tr> <tr><td>Tribal Knowledge ☐</td><td>Rushing ☐</td></tr> <tr><td>LOA ☐</td><td>Product Improvement ☐</td></tr> <tr><td>Substation ☐</td><td>Process Improvement ☐</td></tr> <tr><td>Past Expiry Date ☐</td><td>Manufacturing Process ☐</td></tr> <tr><td>Misidentified ☐</td><td>Past Due ☐</td></tr> </table>				Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>				Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
☒ OTHER: <u>Customer</u>																																																																							

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

Work Order update only



Work Order: <u>146617</u> Part No. <u>D19-646-041</u> NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS							
				Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐	Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☒ Quality ☐ Other ☐				
Date: <u>16/3/16</u>		Step #: <u>240</u>		QTY Effective: _____		MRB (QSI042) Approval DAS 12 <u>16/6/2</u> 9-89					
Description Work Order Deviation				Disposition							
Plug unused holes with AN3C4A Bolts rather than AN3CSA Bolts.				Acceptable AN3C-4A 1 M 1341762 (6)							
				Completed By <u>16/06/2</u> DAS 15							
				Lead hand / Supervisor Approval Verification							
				QC / QA Coordinator Approval							
Root Cause				FAULT CATEGORY							
Environment	☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	☐	Manufacturing Process	☐							
Misidentified	☐	☐	Past Due	☐	OTHER: _____						

